




# STP Patch Panel Installation Instruction

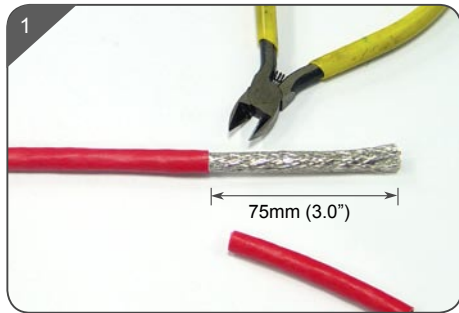


- Strip the outer plastic jacket with appropriate length about 75mm (3.0").

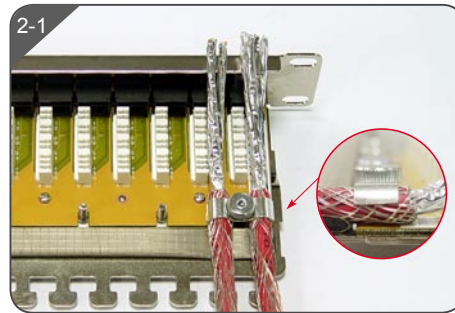


- If STP cable OD < 8.0mm, bend back the copper braid and place braid under the bracket.
- Note:* Please place bracket exactly on the braid bending place.

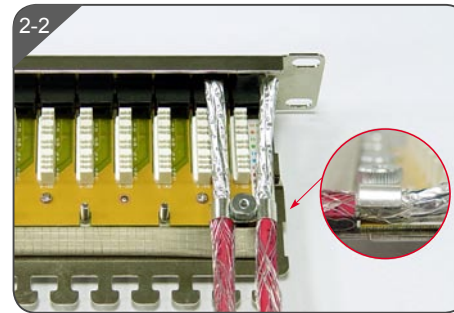


- If STP cable OD > 8.0mm, bend back the copper braid in front of bracket, place entire aluminum foils under the bracket, and screw to the earth directly.

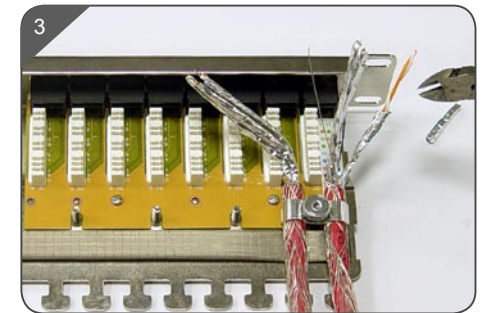


- Cut each single wire's aluminum foil off subject to terminated IDC position length.

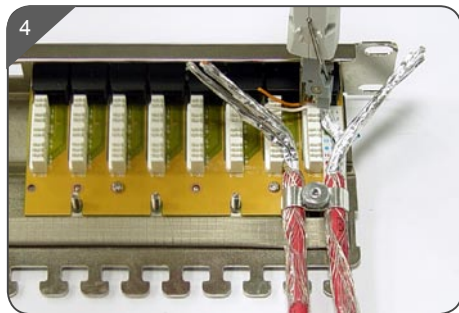


- Arrange the wires according to the color and use punch down tool terminate each pairs.

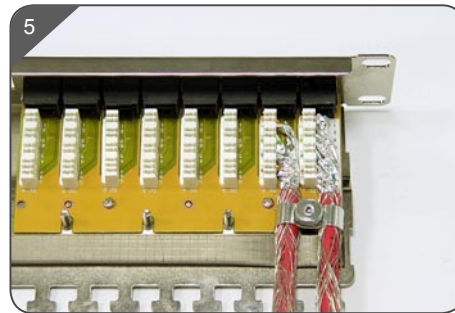


- After termination completed. Please make sure the aluminum foil fully covers the wires.

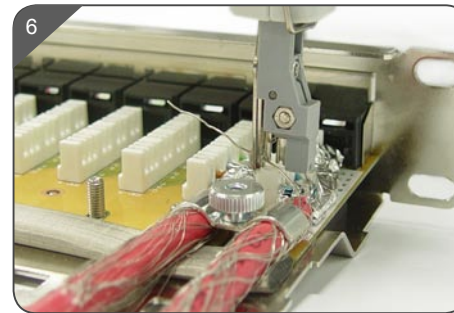


- Please fasten the drain wire on #9 slot of IDC.

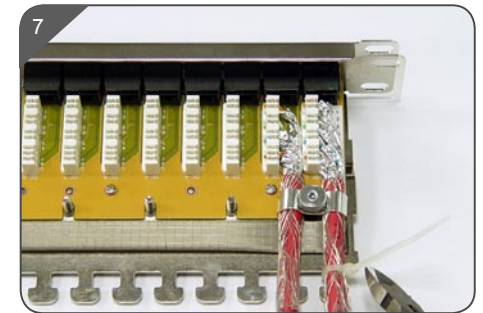

- Thread the cable tie and cut the cable tie. Please do not use too much force to deform the cable.

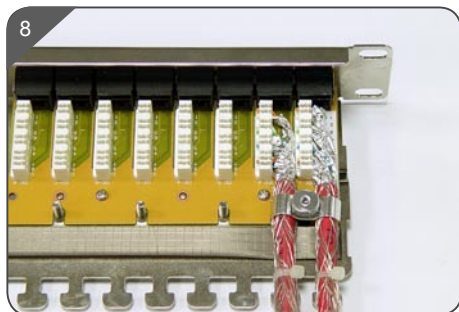


- Complete the wires termination and cable mounting.

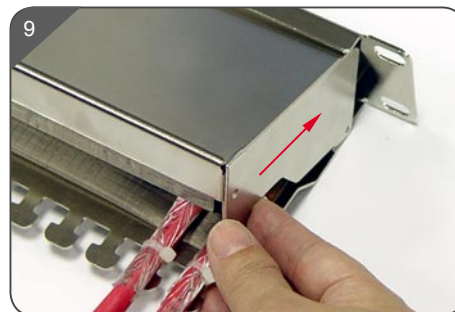

- First, insert the cover front side into the panel hood.



- Push down the cover and snap into knob on each side.

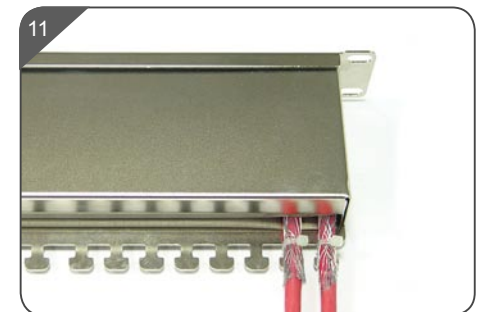

- If you have more cables to install, please reverse step 9 and step 10 to open the cover.

