




STP Patch Panel Installation Instruction

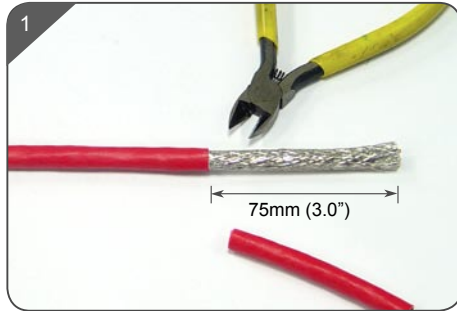


■ Strip the outer plastic jacket with appropriate length about 75mm (3.0").

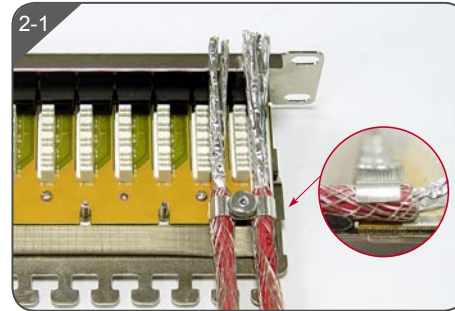


■ If STP cable OD < 8.0mm, bend back the copper braid and place braid under the bracket.
 Note: Please place bracket exactly on the braid bending place.

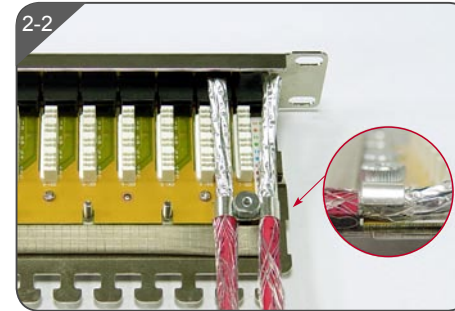


■ If STP cable OD > 8.0mm, bend back the copper braid in front of bracket, place entire aluminum foils under the bracket, and screw to the earth directly.

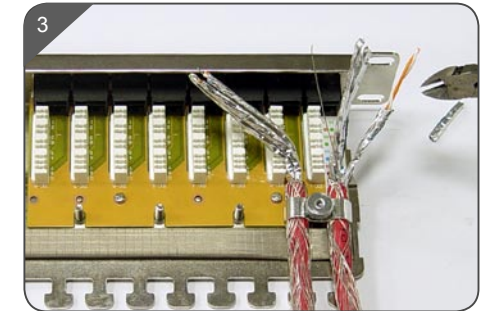


■ Cut each single wire's aluminum foil off subject to terminated IDC position length.

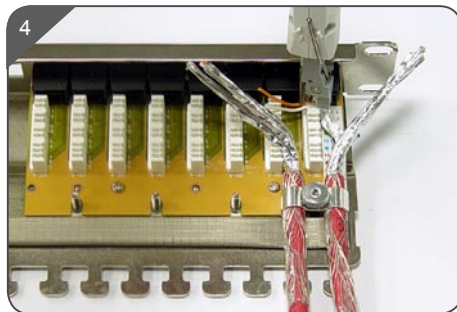


■ Arrange the wires according to the color and use punch down tool terminate each pairs.

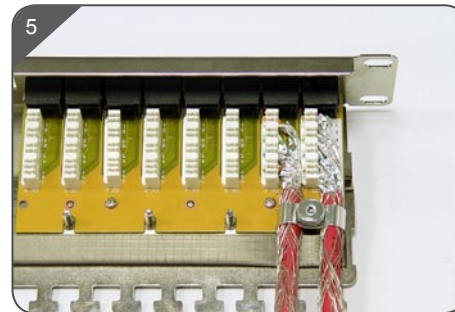


■ After termination completed. Please make sure the aluminum foil fully covers the wires.

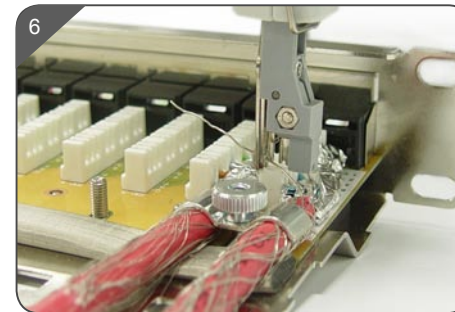

■ Please fasten the drain wire on #9 slot of IDC.

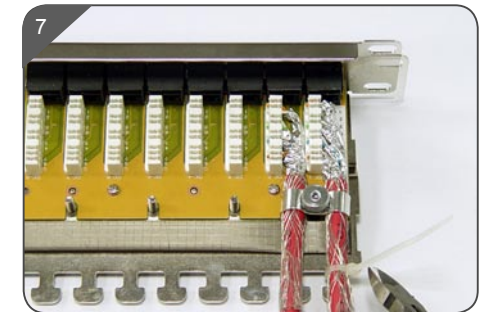

■ Thread the cable tie and cut the cable tie. Please do not use too much force to deform the cable.

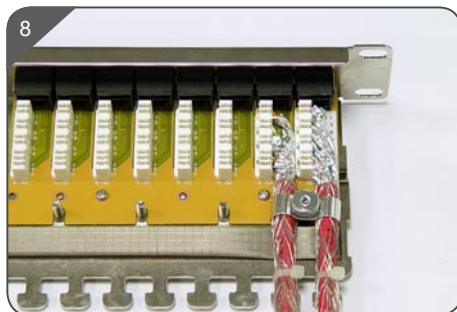


■ Complete the wires termination and cable mounting.



■ First, insert the cover front side into the panel hood.



■ Push down the cover and snap into knob on each side.

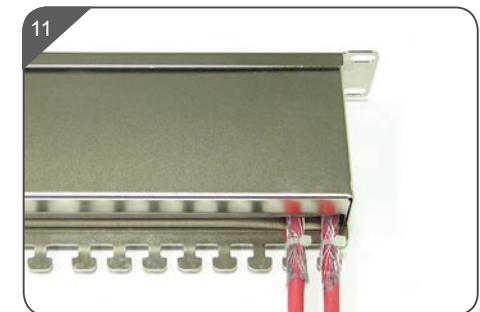

■ If you have more cables to install, please reverse step 9 and step 10 to open the cover.

